Taring

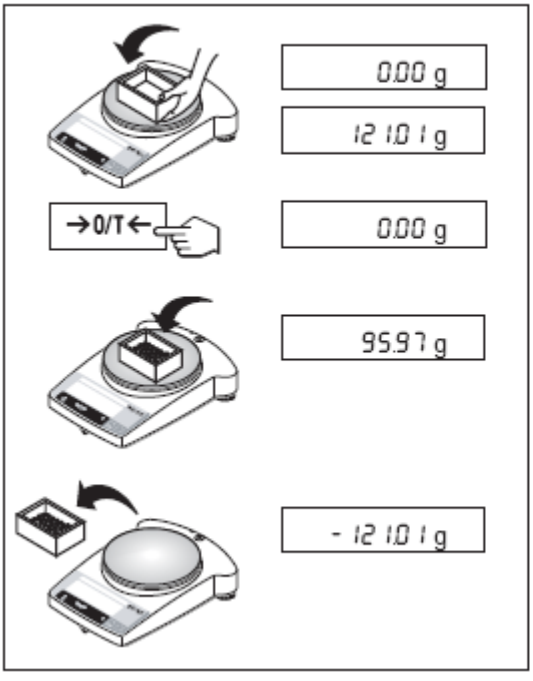

→ Place empty container on the balance.

→ The weight is displayed.

→ Tare: press the «→0/T←» key briefly.

→ Add weighing sample to container. The net weight is now displayed.

If the container is removed from the balance, the tare weight will be shown as a negative value.
The tare weight remains stored until the «→0/T←» key is pressed again or the balance is switched off.