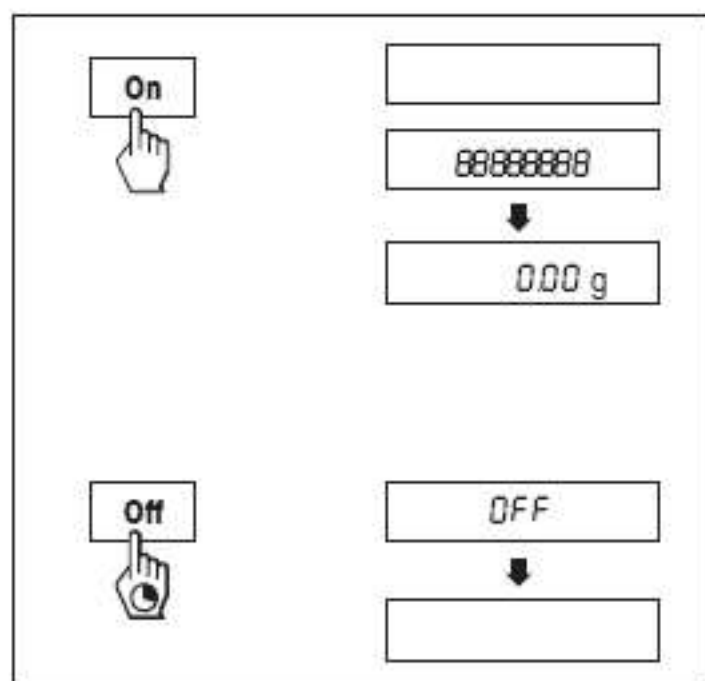# 3 Weighing

3.1 On/off switching
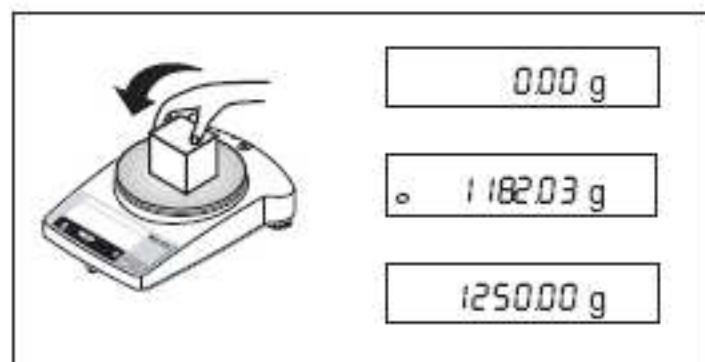

Switching on

→ Remove any load from weighing pan and press «On»
  The balance performs a display test (all segments in
  When zero is displayed, the balance is ready for ope

Switching off

→ Press and hold the «Off» key down until "OFF" appea

3.2 Simple weighing

→ Place weighing sample on the weighing pan.

→ Wait until the stability detector ˜o´ disappears.

→ Read the result.